Technical Bulletin

Bulletin No: TCH-023-007 Effective Date: 12/10/2019 Cancels: N/A Page: 1 of 1

Subject: Potential Brake Pad Fitment Issue on Bendix® ADB22X® Air Disc Brakes

It has come to our attention that some Bendix® ADB22X® Air Disc Brake customers have experienced issues fitting pads into the brake carrier.

If you are experiencing this issue, take the following actions:

- 1. Assess the brake pad fitment within the brake carrier.
- If the brake pads do not have adequate clearance, remove the pads and clean the abutment surface on the carrier with a flat file.
 <u>Do not use power tools</u>. Remove an even amount of material from the entire surface. Wipe clean. See illustrations below.



Bendix® Brake Pad

Abutment Surface Rust



Filing the Abutment Surface



Abutment Surface Rust Removed



- 3. Insert the pads into the carrier and reassess the fitment.
- 4. If the pads do not slide freely into the carrier, repeat Steps 2 and 3. Note: Remove only the amount of material necessary to allow the pads to move freely.
- 5. If the pads still do not fit, swap the positions of the inboard and outboard pads.
- 6. Contact your Bendix representative or the Bendix Tech Team at 1-800-AIR-BRAKE (1-800-247-2725), option 2, for further assistance. Representatives are available Monday through Thursday 8:00 am 6:00 pm and Friday 8:00 am 5:00 pm. You can also reach the Tech Team by email at techteam@bendix.com.

Log On and Learn from the Best

Online training that's available when you are -24/7/365. Visit brake-school.com.

