

Part Number Update

Bulletin No: PNU-247

Effective Date 3/12/2020

Cancels: Same dated 2/27/2019

Page: 1 of 2

subject: New Bendix® TABS-6™ Advanced Multi-Channel Modules - UPDATED

Bendix announces the availability of new Bendix® TABS-6™ Advanced Multi-Channel Module part numbers. See the table below for module changeover details and the back of this document for required wiring changes.



Obsolete

Bendix® TABS-6™ Advanced Multi-Channel Modules



New

Obsolete OE Part No.	AM Part No. (See note 1)	New Part No.		ABS Config.	Trailer Length	Axles	Air Suspension Model	Notes
		OE	AM (See note 2)					
TRSP Not Enabled								
K026502	K028652	K151196	K151303	4S/2M - Side	N/A	N/A	N/A	
K026503	K028653	K151197	K151304	2S/2M - Side				
TRSP Enabled								
K026500	K028522	K152179	K152771	4S/2M - Side	40' to 59'	2	AAZNT 46K or HKANT 40K with SmartLift®	
K028920	K028974	K152184	K152776	4S/2M - Axle	40' to 59'	2	AANT 23K or AANL 23K	ISS for Rear-Dump on AUXIO1, Lift Axle Sensing (LAS) on AUXIO2
K035858	K035862	K152185	K152785	4S/2M - Side	40' to 59'	4	AAT 25K	
K038369	K038370	K152180	K152774	4S/2M - Side	40' to 59'	2	HKANT 40K Ultra-K For SmartLift with C-21800\C-21966 use K152179.	
K039592	K039664	K152183	K152775	4S/2M - Side	40' to 59'	3	AAT 25K HP	
K045480	K045489	K152188	K152811	4S/2M - Side	40' to 59'	2	AAZNT 46K or AAT 23K	
K049647	K049648	K152190	K152863	4S/2M - Side	40' to 59'	2	RAR-260--OS	
K057552	K057554	K152192	K152864	4S/2M - Side	40' to 59'	2	INTRAX® Front: AAL Rear: AANT230	
K068517	K068518	K152193	K152899	4S/2M - Side	40' to 59'	3	HKAT 69K	
K071331	K071332	K152290	K152908	4S/2M - Axle	40' to 59'	2	HNDX AAL 30K\AAT 30K	
K095024	K095025	K152291	K152937	4S/2M - Side	25' to 45'	4	HNDX AAT 30K	
K111180	K111182	K152292	K152939	Side	25' to 59'	1,2,3,4	ANY	
K112591	K112592	K152293	K152942	Axle	25' to 59'			
K119487	K119489	K152294	K152983	4S/2M - Side	20' to 35'	2	AAT 23K	
K129310	K129309	K152295	K153017	4S/2M - Side	20' to 35'	3		
K149295	K149296	K171302	K171305	2S/2M - Side	20' to 35'	1		
K161920	K161921	K171303	K171304	4S/2M - Side	40' to 59'	2	HKANT 40K Ultra-K For SmartLift with C-21800\C-21966 use K152179.	

Notes:


1. Replaces the obsolete OE part number. The AM part includes 2 or 4 speed sensor cables (part number K141692) based on the Electronic Control Unit (ECU) configuration. If the ECU was equipped with a TABS-6 Advanced MC pigtail with the diagnostic, Aux I/O, or Sensor 1 being used, a new pigtail cable must be installed. Refer to the table on the back of this document to find the proper replacement part number.
2. Replaces the new OE part number. No wheel speed sensor adapter cables or new pigtail cable are required.

Subject: New Bendix® TABS-6™ Advanced Multi-Channel Module

When replacing any older Bendix® TABS-6™ Advanced Multi-Channel Module with the new design, the diagnostic, auxiliary, and sensor cables (12-pin connector cable) used with the system must also be replaced. The previous cables **are not compatible** with the new TABS-6 Advanced Module. The old 12-pin cable **must not** be used. Below are the old cable part numbers shown alongside the new replacement cable part numbers required when replacing the Module.

Existing Cable			New Required Cable			Application Notes
OE Part No.	A/M Part No.	Bendix TABS-6 Advanced MC Pigtail Description	OE Part No.	A/M Part No.	Bendix TABS-6 Advanced MC Pigtail Description	
K025593	K025621	Diagnostic - 9"	K143203	K143210	Diagnostic - 9"	Typically used with a Trailer Information Module (TIM) or with a CAN diagnostic connector
K025594	K025622	Diagnostic - 9" Auxiliary - 9"	K143204	K143211	Combined into one: Diagnostic - 9" & Auxiliary - 9"	Typically used with one or more auxiliary features such as lift axle control, rear dump, Bendix® air disc brake pad wear sensing, or low air pressure warning
K027758	K027757	Auxiliary - 9"				
K102972	K102973	Diagnostic - 9" Auxiliary - 9"				
K048988	K048990	Diagnostic - 9" Sensor 1 - 108"	K143206	K143213	Combined into one: Diagnostic - 9" & Sensor 1 - 108"	Used with a spring deflection sensor for spring ride suspensions
K048989	K048991	Sensor 1 - 108"				
K093196	K093200	Auxiliary 1 - 256"	K143207	K143214	Combined into one: Diagnostic - 9" & Auxiliary 1 - 256"	Used in single auxiliary applications such as lift axle or reset to ride
N/A	N/A	Diagnostic - 9" Auxiliary 1 - 256"				

As always, we stand ready to address any questions or concerns you may have regarding these updates. Please contact your Bendix Representative or the Bendix Tech Team at 1-800-AIR-BRAKE (1-800-247-2725), option 2. Tech Team representatives are available to assist you Monday - Thursday 8:00 a.m. - 6:00 p.m. ET and 8:00 a.m. - 5:00 p.m. on Friday.

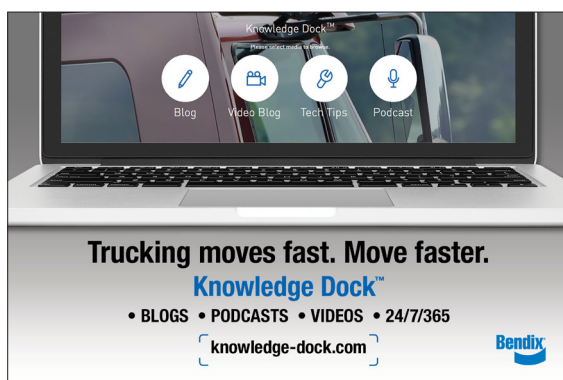

Log-on and Learn from the Best
 On-line training that's available when you are —24/7/365.
 Visit brake-school.com.

